

# Coate Aer ATU Failure

Water seeping to the surface of an exposed septic tank lid is a sign of a blocked drain. This is upflow filter that is not draining properly.



The airline to this motor has been disconnected. If the airline is not secure wastewater is not treated.

# Coate Aer ATU Repair

This is an upflow filter that is properly cleaned and functioning. Gravel is visible and no water is seeping to the surface.



# Jet Inc. ATU Failure



Deteriorating walls is a common failure in upflow filters.

# Jet Inc. ATU Repair



Deteriorating walls can be replaced by installing a new PVC inlet sealed with hydraulic cement.

# Cold Motor



A motor that has not been running for a while will be cold to the touch and wet from condensation. Motors typically run on a thirty minute cycle; fifteen minutes on and fifteen minutes off. Some older systems have a motor with a twenty-four hour cycle. These motors should be set to pump during the day and rest at night.